# Hypertherm®

## **Torch Lead Strain Relief**

Kit: 128549

Field Service Bulletin (P/N 803870)

Revision 0 August, 2000


Hypertherm, Inc. Hanover, NH www.hypertherm.com

© Copyright 2000 Hypertherm, Inc.
All Rights Reserved

Hypertherm, Command, and PAC are trademarks of Hypertherm, Inc., and may be registered in the United States and/or other countries

128549 Contents			
Item	Part Number	Description	Qty.
1	004908	Strain Relief *	1
2	015090	Hose Clamp: 1-5/16 x 2-1/4	1
3	803870	Field Service Bulletin: Robotic THC Strain Relief for PAC184 Torch	1

<sup>\*</sup>Color may differ from picture

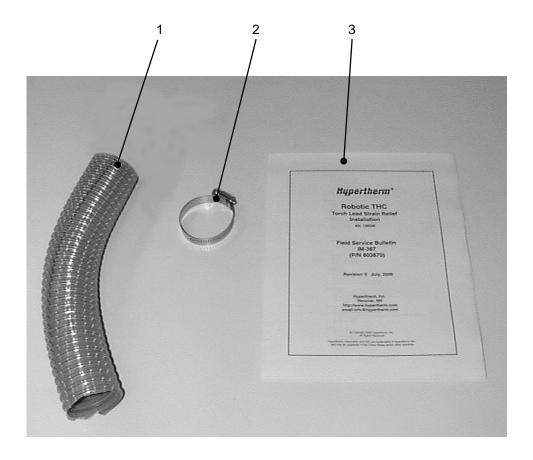




### WARNING ELECTRIC SHOCK CAN KILL

MODIFICATION MUST BE PERFORMED ONLY BY HYPERTHERM TECHNICIANS, DISTRIBUTORS OR QUALIFIED ELECTRONICS TECHNICIANS

Position the ON/OFF circuit breaker on the rear of the power supply to the OFF (O) position and turn the main disconnect switch(es) OFF before any modification work.

### Introduction


Some robotic motions can cause torch lead kinking near the torch sleeve area. To prevent kinking, a strain relief can be mounted to the torch sleeve using this kit and following these instructions.

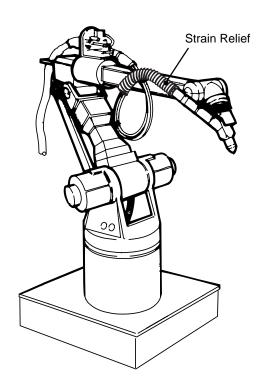

Robotic application with strain relief in place


### **Remove Torch Sleeve**

Uncsrew torch sleeve and slide back to access hose connections.

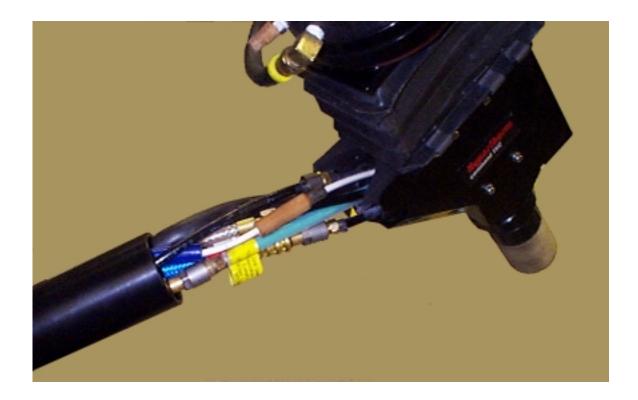

### **Disconnect Hoses**

Undo all hose connections and slide hoses out of torch sleeve.

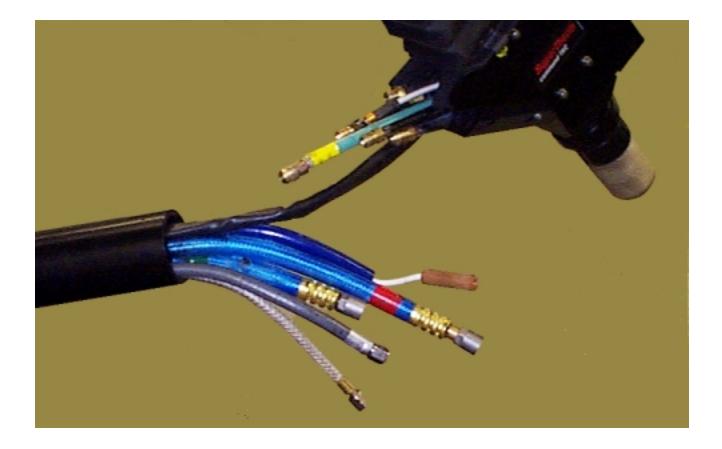

Page 4 Field Service Bulletin


### **Remove Signal Cable Connector Cover**

Note: Be careful not to lose small nuts and bolts.






Route Signal Cables Through Strain Relief
Slide the two signal cables through strain relief and reassemble I/O connector cover.

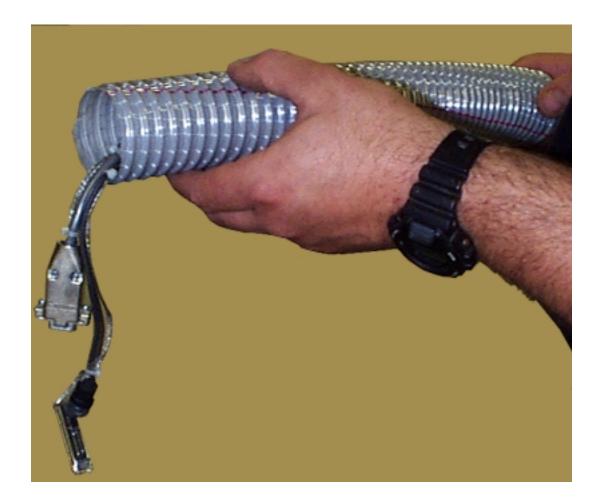


Page 6 Field Service Bulletin

### **Route Hoses Through Strain Relief**

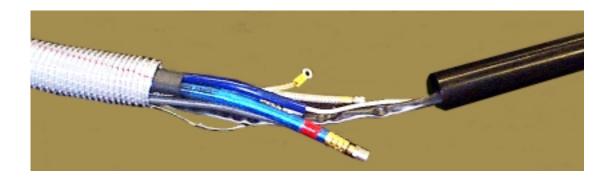

### **Route Hoses Through Sleeve**

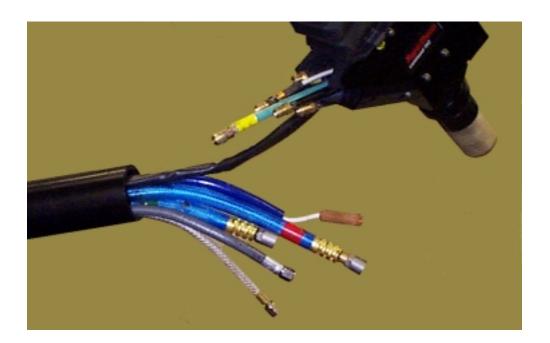

### **Connect Hoses to Torch**



Page 8 Field Service Bulletin

### **Screw on Torch Sleeve to Torch**

### Attach Strain Relief to Torch Sleeve with Hose Clamp

Slide strain relief over torch sleeve, overlapping by 1 inch.

Note: Make sure Plasma vent hose clears end of strain relief.

