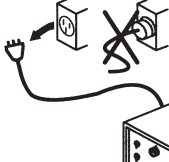
	DANGER ELECTRIC SHOCK CAN KILL
		<p>Disconnect electrical power before performing any maintenance. All work that requires the removal of the power supply cover must be performed by a qualified technician. See the <i>safety Section</i> of the system Manual for more safety precautions.</p>

Introduction

Purpose

This field service bulletin describes the steps necessary to replace the 041920 PC-104 stack with a 141024 PC-104 stack.

Kit 141024 contents

Part number	Description	Qty
PC-104 Stack, consisting of:		
041990	Board 1: HD4070 CPU	1
141022	Board 2: HD4070 IDE Flash with HPR HD4070 Firmware	1
042359	Memory Card: CompactFlash with HPR HD4070 Firmware	1
041622	Board 3: HD4070 Dual Serial	1
041623	Board 4: HD4070 48ChanDigital I/O	1
042357	IC: NEC uPD71055C Parallel Interface	2
041623	Board 5: HD4070 48ChanDigital I/O	1
042357	IC: NEC uPD71055C Parallel Interface	2
041624	Board 6: HD4070 Anlg/Digital	1
041687	Board 7: PC-104 Test	1
229169	Cable: PC-104 Upgrade Power	1
123469	Ribbon Cable: 26/C 20" (B6J1)	1
123470	Ribbon Cable: 50/C 24" (B5J1)	1
123471	Ribbon Cable: 50/C 24" (B5J4)	1
123472	Ribbon Cable: 20/C 21" (B3J1)	1
123473	Ribbon Cable: 50/C 22" (B4J4)	1
123474	Ribbon Cable: 50/C 18" (B1J2)	1
123475	Ribbon Cable: 50/C 31" (B4J1)	1
123490	Ribbon Cable: 34/C (B1J3 Floppy)	1
123491	Ribbon Cable: 40/C 25" (B1J4-B2J2 IDE)	1
108114	Hardware: M3x15 M/F Standoffs	32
805720	FSB:HD4070 PC-104 Replacement Kit	1